

TECHNICAL SERVICE BULLETIN

TSB #:	TSB-VAR117	ENGINE:	ALL 6.0L PRODUCTS
DATE:	01/17/2017	ISSUED BY:	SERVICE

BUILD DATE:

PART #:


APPROVED BY:

ORDER #:


6.0 LITER VARIATIONS

DUE TO THE MANY VARIATIONS AND VIN NUMBER DISCREPANCIES WITH THE 6.0 LITER, IT IS THE INSTALLER'S RESPONSIBILITY TO MAKE SURE THE REMANUFACTURED LONG BLOCK IS CONFIGURED THE SAME AS THE LONG BLOCK YOU ARE REPLACING. OUR WARRANTY WILL NOT COVER THESE ISSUES ONCE THE ENGINE IS INSTALLED IN THE VEHICLE.


FIRST STYLE BRANCH TUBE

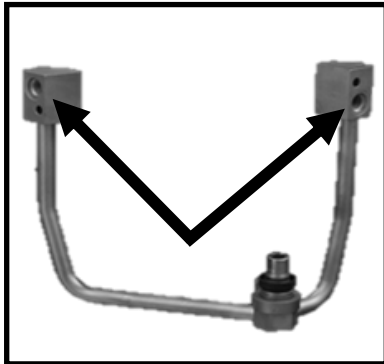

SECOND STYLE BRANCH

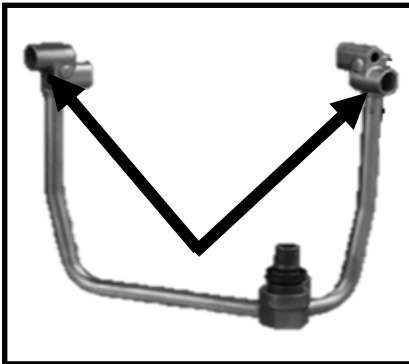

THIRD STYLE BRANCH TUBE

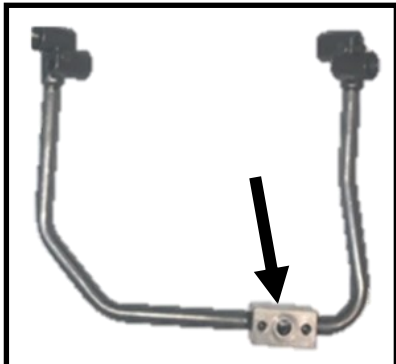

THREADED STAND PIPE CONNECTION WITH QUICK CONNECT OIL PUMP CONNECTION

PRESS IN O-RING CONNECTION WITH QUICK CONNECT OIL PUMP

PRESS IN O-RING CONNECTION WITH NEW STYLE FUEL TUBE CONNECTION

1st STYLE INJECTOR CLAMP



T40 Torx Bolt

2nd STYLE INJECTOR CLAMP



T45 Torx Bolt

1st STYLE OIL MANIFOLD



THE FIRST STYLE OIL MANIFOLD ONLY BOLTS CORRECTLY ONTO THE ROCKER BOX PART # 1840550C1

2nd STYLE OIL MANIFOLD



THE SECOND STYLE OIL MANIFOLD BOLTS ONTO THE ROCKER BOX PART # 1843351C2, 1843351C3, & 1858473C1

PART# 1838901C3, 1838901C4 & OTHERS COMPATIBLE WITH ROCKER BOXES # 1840550C1 (1ST) 1843351C2 (2ND) 1843351C3 (3RD)

PART# 1856237C1 & OTHERS COMPATIBLE WITH ROCKER BOX # 1858473C1 (4TH)