


TECHNICAL SERVICE BULLETIN

BLACKWATER
E N G I N E S

TSB #:	TB-IC 0913	ENGINE:	6.0 LITER POWERSTROKE AND 6.0 LITER NAVISTAR VT 365
DATE:	10/30/2013	REVISION:	5/20/2016

6.0 LITER INJECTOR CLAMP CLEARANCE BULLETIN

IT IS SOLELY THE RESPONSIBILITY OF THE INSTALLER TO VERIFY THE CLEARANCE OF THE INJECTOR CLAMP. FAILURE TO DO SO WILL CAUSE DAMAGE TO THE ENGINE AND WILL NOT BE COVERED UNDER WARRANTY.

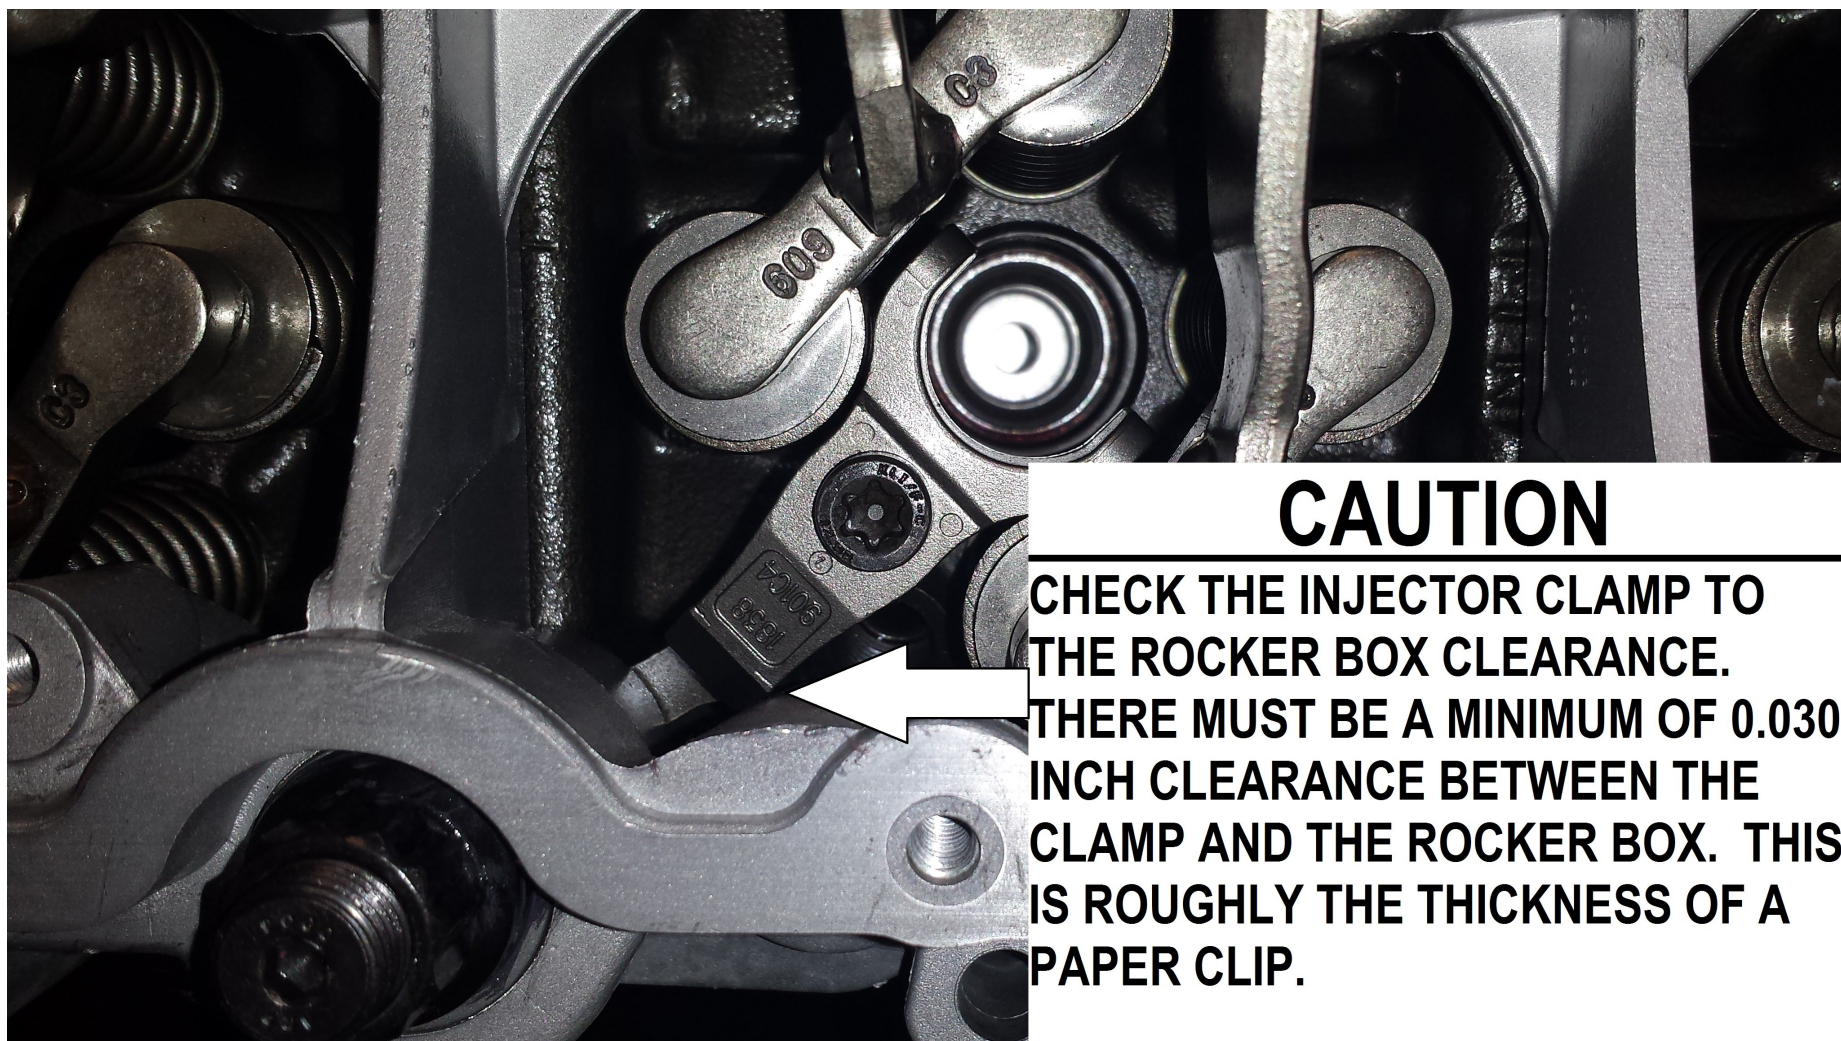

CAUTION

CHECK THE INJECTOR CLAMP TO THE ROCKER BOX CLEARANCE. THERE MUST BE A MINIMUM OF 0.030 INCH CLEARANCE BETWEEN THE CLAMP AND THE ROCKER BOX. THIS IS ROUGHLY THE THICKNESS OF A PAPER CLIP.